Three-point belt with automatic reel

made by Klippan

Model	116.020	up to chassis end No.	075 993
	116.024, 025		072 157
	116.028, 029		036 858
	116.032, 033		058 918
	116.036		001 650

Note


If the belt end fitting of the safety belt is damaged in the course of an accident, replace complete safety belt.

Characteristic damage

Belt end fitting is deformed, that is, the formerly offset end is now straight.

Belt end fitting is damaged by fastening screw (arrow).

In addition, the plastic coating of the lock catch may show chafe marks and there may be bright spots at belt in range of belt guide fitting and catch.

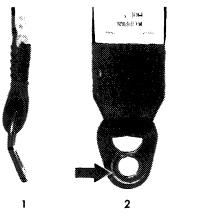



191 - 10606

- 1 Belt end fitting undamaged 2 Belt end fitting damaged 3 Belt end fitting deformed during an accident

Model	116.020	starting chassis and No. 075 994
	116.024, 025	072 158
	116.028, 029	036 859
	116.032, 033	058 919
	116.036	001 651

Note

Renewal of a complete safety belt or individual damaged parts, such as holders, lock or holding rail, depends on visible deformations.

Characteristic damage

1 Lock with holder begins to stretch. Driver's seat can still be correctly adjusted.

Remedy:


Exchange lock and holder.


- A lock undamaged
- B lock deformed by accident
- 2 Holding rail deformed. Driver's seat can no longer be adjusted.

Remedy:

Replace complete safety belt as well as damaged holding reail.

- A holding rail undamaged
- B holding rail deformed by accident

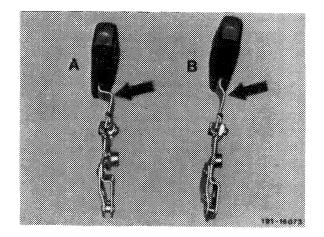

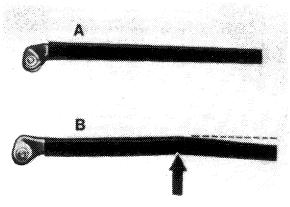

191-16072