Coordination piston - cylinder

| Version 1) | Group no. | Piston dia. | Cylinder dia. |
|------------|-----------|-----------------------|-----------------------|
| Canadand | 0 | 90.845 - 90.855 | 90.898 - 90.908 |
| Standard | 1 | above 90.855 - 90.865 | above 90.908 - 90.918 |
| | 2 | above 90.865 - 90.875 | above 90.918 - 90.928 |

Cylinder bore

| Max. wear limit in forward or transverse direction | 0.10 | |
|-----------------------------------------------------------------------------------------------------------|------------|-------------------|
| Permissible out-of-true and conicity | when new | 0.014 |
| remissible out-or-true and comonly | wear limit | 0.05 |
| Permissible deviation vertically in relation to crankshaft center line, with reference to cylinder height | | 0.05 |
| Permissible roughness | | 0.002-0.004 |
| Permissible waviness | | 50 % of roughness |
| Honing angle | | 25° |
| Chamfer of cylinder bores | | refer to Fig. |


 $^{^{\}rm 1}\, {\rm These}$ engines have no repair steps.


Note

In addition of a visual checkup, in particular in the event of complaints about "high oil consumption" measuring of cylinder bores is unavoidable.

For this purpose, measure the clean cylinder bores with internal measuring instrument at measuring points, 1, 2 and 3 in longitudinal direction A (piston pin center line) and in transverse direction B.

With piston installed, the measuring point 3 is barely above piston, at BDC.

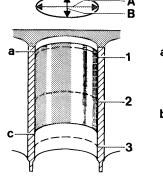

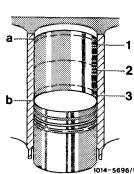

a Upper reversing point of 1st piston ring

b BDC of piston

c Lower reversing point of oil scraper ring

Chamfer cylinder bores after boring.

For honing, the material allowance should not exceed 0.03 mm.

